

Staveley and Copgrove P C

Play Area Inspection



Inspected by Park Lane Playgrounds



5th June 2017 at 9.25am



Unit: Wicksteed Whirly Bird
Year of Manufacture: 2000
Overall Condition: Good
Comments: Paintwork showing signs of wear
 Moss and weeds on safety surface

(See Appendix A)

Surfacing: Wetpour



Unit: Record Cradle Swings
Year of Manufacture: Unknown
Overall Condition: Good
Comments: cable ties do not
 comply with BS EN1176 standards
 Moss on the seats and surface
 Lubricate the bushes and shackles

(See Appendix A)

Surfacing: Wetpour
 Crack in the wetpour, repair to prevent
 any further deterioration.



Unit: Record Flat Seat Swings
Year of Manufacture: Unknown
Overall Condition: Good
Comments: cable ties do not comply with
 BS EN1176 standards
 Moss and debris on the safety surface
 Mole hills around the edge of the surface

(See Appendix A)

Surfacing: Wetpour




Unit: Hags Multi Pondo
Year of Manufacture: 2000
Overall Condition: Good
Comments: Moss on the safety surface

Surfacing: Wetpour



Unit: Play and Leisure Multi Unit
Year of Manufacture: 2000
Overall Condition: Good
Comments: Paint corrosion

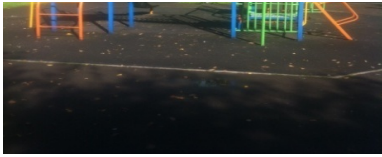

Chains showing signs of wear
 Moss and weeds on the area
(See Appendix A)
 Surfacing: Wetpour



Unit: Play and Leisure Fish Spring Mobile
 Year of Manufacture: 2006
 Overall Condition: Good
 Comments: Moss on the safety surface
 Mole hills around the unit
 Surfacing: Wetpour




Unit: Ledon Car Spring Mobile
 Year of Manufacture: 2002
 Overall Condition: Good
 Comments: Moss on safety surface,
 Replace the clamp
(See Appendix A)
 Surfacing: Wetpour



Unit: Bench
 Year of Manufacture: Unknown
 Overall Condition: Good
 Comments:
 Surfacing: Rubber Grassmat



Unit: Goalposts
 Year of Manufacture: Unknown
 Overall Condition: Average
 Comments: Both goals slightly loose in ground-monitor
 until next inspection
 Moles hills on the area
(See Appendix A)
 Surfacing: Grass

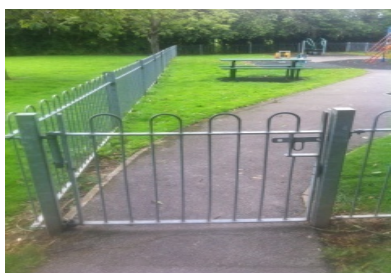


Unit: Fencing and Gates
 Year of Manufacture: Unknown
 Overall condition: Average
 Comments: Drop Pin Missing on Vehicle Access Gate
 1 no post loose in ground, moss on fence
 and pedestrian gate.
 The bottom crook is coming out on

the timber
gate
(See Appendix A)

Appendix A

Whirley bird

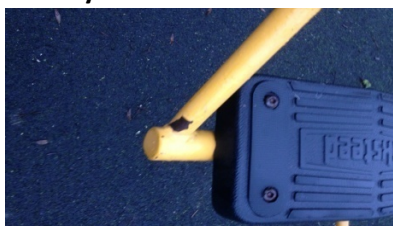

Comments:
Paintwork showing signs of wear

Recommendation:
Monitor until next inspection



Comments:
Weeds and moss on the surface

Recommendations:
Remove the moss and weeds

Cradle Swings



Comments:
Cable ties do not comply with BS EN1176 standards

Recommendation:
Monitor cable ties for any sharp edges



Comments:
Moss on the safety surface

Recommendations:
remove moss



Comments:
Moss on the seats

Recommendations:
Remove the moss so the swings can be used



Comments:



Crack in the wet pour

Recommendations:

Repair the crack to prevent further deterioration



Comments:

Mole hills around the edge of the surface

Recommendations:

Remove the mole hills

Multi Unit



Comments:

Paint corrosion

Recommendation:

Sand down and re-paint that complies with EN1176.4.1.1 standard.



Comments:

Chains showing signs of wear

Recommendation:

Monitor chains until next inspection



Comments:

Moss on the surface area

Recommendations:

Remove the moss



Springers



Comments:

Clamps showing signs of wear

Recommendation:



Replace the clamps



Comments:
Moss on the surface

Recommendations:
Remove the moss



Comments:
Mole hills around the area

Recommendations:
Remove the mole hills

Fencing and Gates



Comments:
Drop pin missing on vehicular Access Gate

Recommendation:
Replace Drop pin



Comments:
1 no post loose in ground

Recommendation:
Secure loose post



Comments:
Moss on pedestrian gate and fencing

Recommendation:
Remove moss from fencing and gate



Comments:

Crook loose on the gate

Recommendations:

Secure the crook



Comments:

Mole hills on the area

Recommendations:

Remove the mole hills

***The foregoing report is a true representation of the play area at the time of inspection.
The Inspection was entirely visual and no equipment was dismantled.***